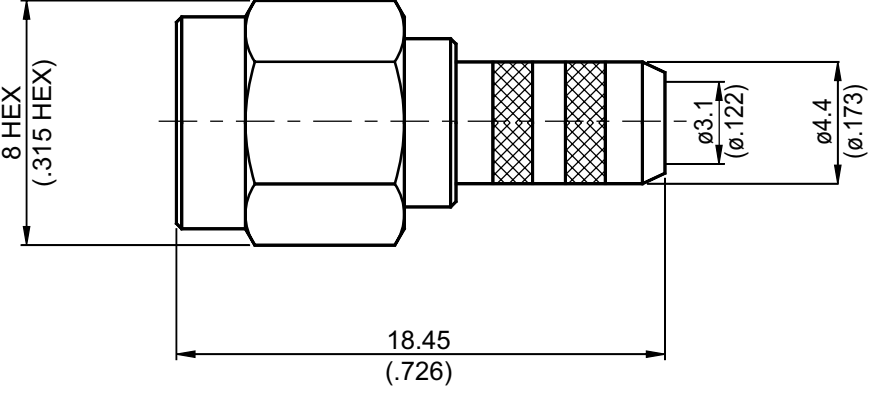


SMA3100-0142	SMA Plug Crimp	50Ω																								
																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="width: 20%;">Parts</th> <th style="width: 20%;">Material</th> <th style="width: 60%;">Plating (Micro-inch)</th> </tr> </thead> <tbody> <tr> <td>Ferrule</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Contact Pin</td> <td>Brass</td> <td>Gold 20 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Renber Ring</td> <td>Beryllium Copper</td> <td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td> </tr> <tr> <td>Gasket</td> <td>Silicon</td> <td></td> </tr> <tr> <td>Insulator</td> <td>Teflon</td> <td></td> </tr> <tr> <td>Body</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Coupling Nut</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> </tbody> </table>			Parts	Material	Plating (Micro-inch)	Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50	Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50	Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Insulator	Teflon		Body	Brass	Gold 5 Over Nickel 50 Over Copper 50	Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50
Parts	Material	Plating (Micro-inch)																								
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50																								
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50																								
Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Gasket	Silicon																									
Insulator	Teflon																									
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50																								
Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50																								
<p>Weight: 3.88 g</p> <p>Suitable Cables: RG55, RG142, RG400, RG142-E</p>																										

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMA3100-0142

JYE BAO CO., LTD.

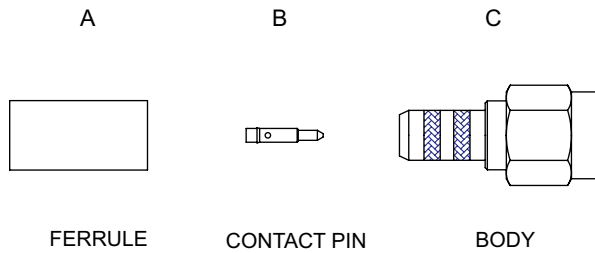


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y".
	Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "C" IN PLACE.
	Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "C" AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.