


MCX3100-9316

MCX Plug Crimp Right Angle  $50\Omega$ 

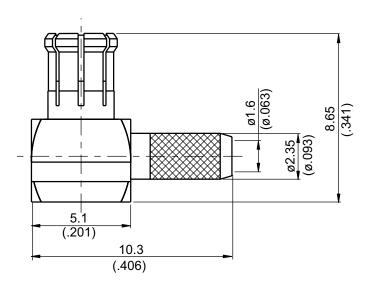

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Cover	Brass	Gold 5 Over Nickel 50 Over Copper 50
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Body	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50

Weight: 1.18 g

Suitable Cables: RG174, RG188, RG316, RG316-E

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



## **CABLE ASSEMBLY INSTRUCTION** MCX3100-9316 JYE BAO CO., LTD. С D В Α **FERRULE** COVER WASHER BODY ASSEMBLY INSTRUCTION DIAGRAM Step 1: STRIP AS SHOWN. 3.2 [.126] 2.1 [.083] Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "B" AND SOLDER IN "Y". Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "B" AND CRIMP. FORCE Step 6: PRESS ON THE TOP OF "C" "D" WITH JIGS.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.