

SMA33NP-0047	SMA Plug Solder	50Ω																					
<p style="text-align: center;">EPOXY CAPTIVATED</p>																							
<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="width: 20%;">Parts</th> <th style="width: 20%;">Material</th> <th style="width: 60%;">Plating (Micro-inch)</th> </tr> </thead> <tbody> <tr> <td>Contact Pin</td> <td>Brass</td> <td>Gold 20 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Renber Ring</td> <td>Beryllium Copper</td> <td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td> </tr> <tr> <td>Gasket</td> <td>Silicon</td> <td></td> </tr> <tr> <td>Insulator</td> <td>Teflon</td> <td></td> </tr> <tr> <td>Body</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Coupling Nut</td> <td>Stainless</td> <td>Passivated</td> </tr> </tbody> </table>			Parts	Material	Plating (Micro-inch)	Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50	Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Insulator	Teflon		Body	Brass	Gold 5 Over Nickel 50 Over Copper 50	Coupling Nut	Stainless	Passivated
Parts	Material	Plating (Micro-inch)																					
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50																					
Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																					
Gasket	Silicon																						
Insulator	Teflon																						
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50																					
Coupling Nut	Stainless	Passivated																					
Weight: 3.42 g Suitable Cables: Semi-rigid.047																							

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMA33NP-0047

JYE BAO CO., LTD.

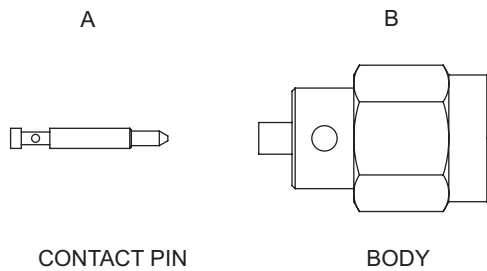


DIAGRAM	ASSEMBLY INSTRUCTION
<p>2.5 [.098]</p>	<p>Step 1: STRIP AS SHOWN.</p>
<p>A</p> <p>Y</p> <p>USE 0.55MM GAGE</p>	<p>Step 2: PUT 0.55 MM GAGE IN PLACE, INSERT CABLE'S CENTER CONDUCTOR INTO CENTER PIN "A" AND SOLDER IN "Y".</p>
<p>B</p>	<p>Step 3: SLIDE THE CABLE INTO CONNECTOR BODY "B".</p>
<p>ST-047</p> <p>ST-008</p> <p>X</p> <p>T</p> <p>S</p> <p>ST-011</p>	<p>Step 4: PUT PREPARED CABLE INTO SOLDERING FIXTURE "ST-008" AND LOCK IT. PUT BODY AS SHOWN.</p> <p>Step 5: SCREW LOCATOR TOOL "ST-011" TO THE POSITION AS SHOWN IN "S". SOLDER IN "X" AND PUT EPOXY IN "T".</p>

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.