



SMA9100L-0316

## SMA Reverse Polarity Jack Crimp For Bulkhead

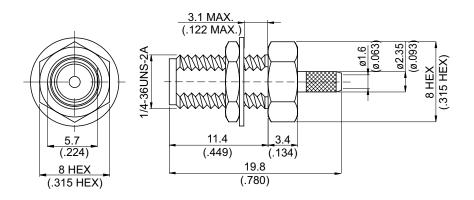

## MOUNTING HOLE:

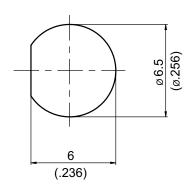

	Parts	Material	Plating (Micro-inch)
	Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
	Hex Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50
-	Lock Washer	Brass	Gold 5 Over Nickel 50 Over Copper 50
	Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50
	Barrel	Brass	Gold 5 Over Nickel 50 Over Copper 50
-	Insulator	Teflon	
-	Body	Brass	Gold 5 Over Nickel 50 Over Copper 50

Weight: 3.65 g

Suitable Cables: RG174, RG188, RG316, RG316-E, RG316-FEP

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



## CABLE ASSEMBLY INSTRUCTION SMA9100L-0316 JYE BAO CO., LTD. С В **FERRULE** CONTACT PIN **BODY+HEX NUT** LOCK WASHER ASSEMBLY INSTRUCTION DIAGRAM 13.7 [.539] Step 1: STRIP AS SHOWN. 2.5 [.098] Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y". Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "C" IN PLACE. Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "C" AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.